




LPS[®] DL SERIES

INSTALLATION INSTRUCTIONS

The LPS[®] DL Series are Surge Protective Device (SPD) for High Frequency data communication system. The Standard Clamping voltage @ 1mA is:

- 9.5V for DL -(*) / 7.5
- 27V for DL -(*) / 24

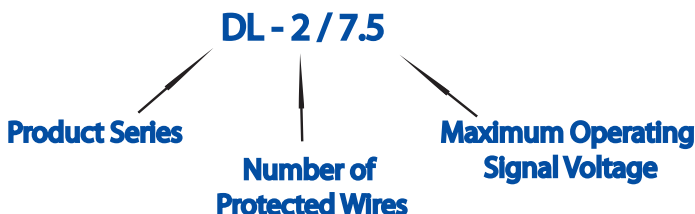

TECHNICAL SUPPORT

T: +603-7980 5911 E: info@lpssystem.com


Safety Precautions & Installation Procedures

1. Do not install during thunderstorm.
2. Turn Off power supply to all equipment to be protected.
3. Verify that the equipment chassis is earthed.
4. Add a 2.5mm² green ground wire to G of **equipment terminal** of SPD and connect the other end (with cable lug) to the metal chassis equipment by;
 - i. Removing a screw on the metal chassis that is within reach of the ground wire.
 - ii. Removing any paint around the screw hole.
 - iii. Tightening screw with ground wire cable lug under it.
 - iv. If equipment has no metal chassis, connect the ground wire to the nearest power socket earth / earthed metal equipment rack / earthed metal bracket which support the equipment.


5. Cut the incoming data line to less than 1 meter away from the equipment.
6. Strip about 50mm of cable jacket to expose wires.
7. Strip about 6mm of wire insulator to expose conductor.
8. Connect the incoming data line to L of LINE terminal of the SPD and then connect the cable screen to S of LINE terminal.
9. Connect the equipment data line to L of EQUIPMENT terminal of the SPD and then connect the screen to S of EQUIPMENT terminal following the same procedure used in step 6 & 7.
10. **In case the cable has no screen connect all unused S to G at both LINE terminal and EQUIPMENT terminal.**
11. Apply power to the now protected equipment.

Trouble - shooting

1. Check to see if your equipment is turned on.
2. Inspect all connections
3. Remove and by - pass SPD and verify proper operation. If the system comes back on line without the SPD installed, chances are the SPD has been damaged by excessive surge. Replace the SPD as soon as possible with a new SPD. It is not advisable to run the system without SPD.

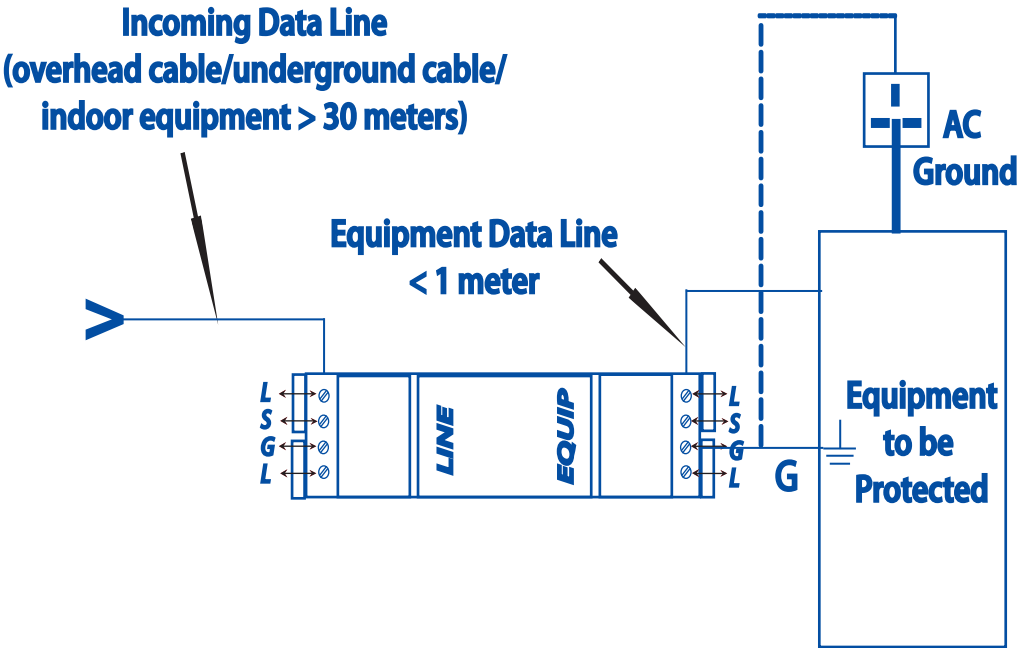


DL - 2 / (*)

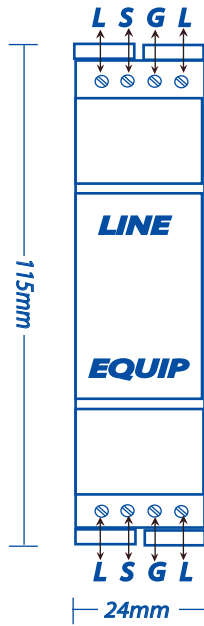

DL - 4 / (*)



SIDE VIEW

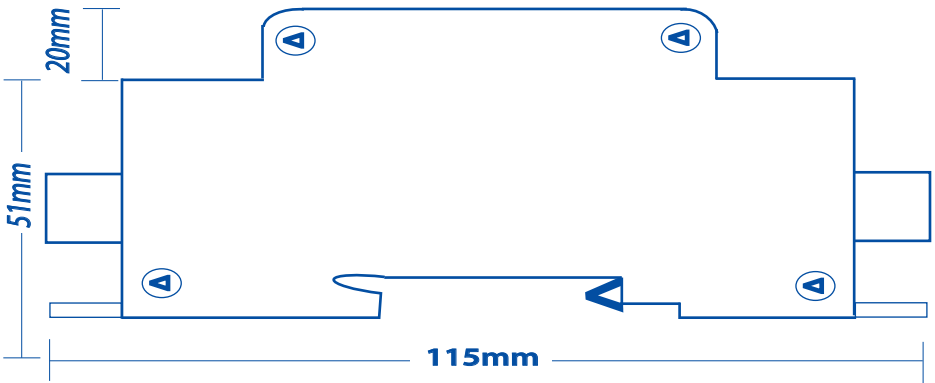

Important Note:

- All LPS[®] Products must be connected to Power Earth, directly or indirectly.
- All connecting leads must be as short & as straight as possible. The SPD must be less than 300mm away from the equipment to be protected.

